

Service Bulletin



Applies To: 2005 Accord Hybrid - JHMCN36..5C000001 thru JHMCN36..5C014296

October 25, 2005

MIL Comes On With DTC P0135, P0155, P0462, or U0110

SYMPTOM

The MIL is on with one of these DTCs:

- P0135 [rear A/F sensor (bank 1, side 1) heater circuit malfunction]
- P0155 [front A/F sensor (bank 2, side 1) heater circuit malfunction]
- P0462 (fuel level sensor circuit low voltage)
- U0110 (IMA-CAN malfunction)

PROBABLE CAUSE

When the 12 volt battery voltage is low, the PGM-FI software will set these DTCs.

CORRECTIVE ACTION

Update the PCM software.

SOFTWARE INFORMATION

HDS Version:

1.018.016 (or later)

PGM-FI Program ID:

CJA560

PGM-FI Program Part No: 37805-RCJ-A56

WARRANTY CLAIM INFORMATION

in warranty: The normal warranty applies.

Operation Number: 1255A2

Flat Rate Time:

0.3 hour

Failed Part:

P/N 37820-RCJ-A56

H/C 7995269

Defect Code:

03214

Symptom Code:

03203 Repair Technician

Skill Level:

05-057A Template ID:

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

DIAGNOSIS

Connect the HDS to the DLC, and check for DTCs in the PGM-FI section. In the freeze data, check the battery voltage.

Is the freeze data battery voltage less than 10.5 volts?

- · YES Go to REPAIR PROCEDURE.
- · NO Continue with normal DTC troubleshooting.

REPAIR PROCEDURE

Update the PGM-FI software using HDS version 1.018.016 or later. To update the PGM-FI software, refer to service bulletin 01-023, Updating Control Units/ Modules.

© 2005 American Honda Motor Co., Inc. - All Rights Reserved

ATB 30711 (0510)

1 of 1

